

Work Order ID 145982

Friday, May 06, 2016 8:56:35 AM

145982

Page 1

Item ID: D205-634-041

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 5/16/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 5/24/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: dem Date: 16/05/06 Tooling: _____ Date: _____Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D2580-041	G

100	Document Control	0.00
-----	------------------	------

100

DC

DOCUMENT CONTROL

Memo

0.00

Doc.Control -USB or Paperwork

Photocopy D205-634 bluefile & type labels per PPP D205-634-041 CHG005

DAS
27
9-89

JUN 2 8 2016

110

0.10

110

CNC Bend 1

CNC Delta 100 Bender

BENDING MACHINE - SKIDTUBES

Memo

0.40

1-Bend as per program D2580.C on CNC Bender and Folio 10

2-Cut tubes as per Dwg. D2580

3- scribe batch# in aft end of tube

DAS
19
9-89

16-66

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence				
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____							
Misidentified ☐	☐ Past Due								

Work Order ID 145982

Friday, May 06, 2016 8:56:35 AM

145982

Page 2

Item ID: D205-634-041

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 5/16/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 5/24/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

0.00

120

Skidtubes

Memo

1- Deburr ends and remove bending marks

2- Prepare tube for welding as per QSI 004

1.26

130

QC5- Inspect part completeness to step on W/O

0.00

130

QC

Memo

0.02

Quality Control

16-6-7 M.G.

DAS
18
9-89

1 16-06-08

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Work Order ID 145982

Friday, May 06, 2016 8:56:35 AM

145982

Page 3

Item ID: D205-634-041

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 5/16/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 5/24/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140

0.00

140

Skidtubes

Skidtubes

Memo

1.53

1-Weld step D2576 as per Dwg. D2580 and QSI004
A/R Aluminum Rod *m134442*

2-Grind welds on step as per Dwg D2580

3- Insert D4202-1 spacer, swage as per QSI002 and trim/ grind flush per QSI002
and dwg. Hold x-bolt with DT9701 Use tube expander 1/2 x17G to start
expantion and finish with 1/2 x 18G to achieve dwg dimention.4-Drill holes for wearplates using DT 8217 & DT8937, 7.40" from most fwd
saddle holes (ref only) Open holes to 19/64", adjust stopper not to hit
web. Debur

6-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Debur

7-Drill pilot holes for Tow ring using DT8091, open to .640" and Debur

*7 BE 16-06-08***DAS
19
9-89***16-6-8 M.G**16-6-8***DAS
19
9-89**

150

QC10- Inspect visual per QSI004- ground welds

0.00

150

QC

Quality Control

Memo

0.00

*① 16-06-09***DAS
9
9-89**

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Work Order ID 145982

Friday, May 06, 2016 8:56:35 AM

145982

Page 4

Item ID: D205-634-041

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 5/16/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 5/24/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160 *160* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.02							DAS 9 5-39
170 *170* HandFinish Hand Finishing	Pressure Wash per QSI005 4.3 Memo Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch and leave fwd cap out of solution.	0.00 0.52							16-6-21 22
180 *180* Powdercoat Powder Coating	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum m 134631 Memo START TIME: 11:40 OVEN TEMPERATURE: 320° FINISH TIME: 12:10	0.00 0.31							1 1606-23 333

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		

Root Cause				FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER : _____							
Misidentified	☐	Past Due	☐								

Work Order ID 145982

Friday, May 06, 2016 8:56:35 AM

145982

Page 5

Item ID: D205-634-041

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Stop ***NS2***Start Date: 5/16/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 5/24/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
190	QC3- Inspect Part Finish	0.00							
190									
QC	Memo	0.01							
Quality Control									

DAS
15
9-88

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause				FAULT CATEGORY					
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Work Order ID 145982

Friday, May 06, 2016 8:56:35 AM

145982

Page 6

Item ID: D205-634-041

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 5/16/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 5/24/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
200		0.00							
200		1.56							
HandFinish	Memo								
Hand Finishing	1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates A/R Sikaflex-291 <u>M134743</u> Sikaflex expire date: <u>16112</u>								
	2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580 <u>RTU 598 M134524 16107</u>								
	3-Inspect for foreign object per QSI 024								
	4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive A/R Sikaflex-291 <u>M134743</u> Sikaflex expire date: <u>16112</u>								
	5-Wing Walk as per Dwg D2580 and QSI 005 4.4 Batch: <u>M134948</u>								

1x / all 16106/24

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	

Root Cause				FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER : _____							
Misidentified	☐	Past Due	☐								

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : ☐			

Friday, May 06, 2016 8:56:34 AM

145982

D205-634-041

Required Date: 5/24/2016

Required Qty: 1.00

Comments: IPP Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30
KJ IPP Rev P 10.02.19
per PAR09-043 EC verified by:DD
IPP Rev. O 06.02.28 Added paperwork EC
IPP Rev:P 07-07-09 SS Wearplates & Gaskets JLM IPP Rev:Q
10.12.01 as per chg003 DD verf:EC IPP REV:R 12.01.23 AS
PER ECN11-684 VEF:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D4202-1 *D4202-1* Spacer		Manufactured	No			140	Each	308.0000	20	20		16-6-8	
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				LG001	141708			308					
								308					
D2580-1 *D2580-1* 205 Bent Tube		Manufactured	No			110	Each	4.0000	1	1		16-6-6	
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				LG002	145011			4					
					144542			4					
D2576-3 *D2576-3* Step (Machining Detail)		Manufactured	No			140	Each	12.0000	1	1		16-6-8	
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				LG001	136730			12					
					142485			1					
								11					

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Page 2

Friday, May 06, 2016 8:56:34 AM

Work Order ID: 145982

145982

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 5/16/2016

Required Date: 5/24/2016

Start Qty: 1.00

Required Qty: 1.00

D2855 Manufactured No 200 Each 45.0000 1 1

D2855

Cap

Jll 16/06/2016

LocationLoc QtyLoc Code

FP001

45

134027

17

137568

28

X1

AN3-5A Purchased No 200 Each 318.0000 2 2

AN3-5A

Bolt

Jll 16/06/2016

LocationLoc QtyLoc Code

FP001

26

M135058

X2

m133686

2

m134055

24

ST350

292

m134502

292

NAS1149D0332J Purchased No 200 Each 884.0000 2 2

NAS1149D0332.J

Washer

Jll 16/06/2016

LocationLoc QtyLoc Code

CA

6

m129682

6

FP001

11

m133988

11

GA

60

m132677

60

ST264

807

m134502

807

X2

Friday, May 06, 2016 8:56:34 AM

Shop Packet Print

Page 2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Picklist Print

Friday, May 06, 2016 8:56:34 AM

Page 3

Work Order ID: 145982

145982

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 5/16/2016

Required Date: 5/24/2016

Start Qty: 1.00

Required Qty: 1.00

ALS7-1032-130

AELS8-1032-130

Purchased

No

200

Each

1,328.000

50

50

AI S7-1032-130

✕

ALS7-1032-130

1 M1134502

(x50)

**

all 16/06/2016

Rivnut

Location

Loc Qty

Loc Code

FG

50

M128649

50

FP001

43

M128649

43

st549

1235

M128649

1235

AN3C4A

Purchased

No

200

Each

955.0000

50

50

AN3C4A

**

all 16/06/2016

Bolt

Location

Loc Qty

Loc Code

FG

20

122814

20

FP001

323

M133440

7

M134396

41

M134509

246

M134606

29

OVER002

500

M134502

200

M134676

300

ST350

112

M134134

18

M134396

94

M134762

x50

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Picklist Print

Friday, May 06, 2016 8:56:34 AM

Page 4

Work Order ID: 145982

145982

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 5/16/2016

Required Date: 5/24/2016

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0332R

Purchased

No

200

Each

3,049.000

50

50

NAS1149C0332R

WASHER

lll 16/06/24

Location

Loc Qty

Loc Code

FP001

1582

11134462

150

m132262

4

m132930

1004

m134063

446

m134073

128

GA

225

m133284

225

ST266

1242

m134474

142

m134574

1000

m134654

100

D3566-13

Manufactured

No

200

Each

32.0000

1

1

D3566-13

Gasket Fwd

lll 16/06/24

Location

Loc Qty

Loc Code

FG

2

98908

2

FP001

30

138858

2

144947

28

X

Friday, May 06, 2016 8:56:34 AM

Shop Packet Print

Page 4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	

Root Cause			FAULT CATEGORY					
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐			
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐			
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐			
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐			
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐			
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐			
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐			
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐			
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐			
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐			
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____						
Misidentified ☐	Past Due ☐							

Picklist Print

Page 5

Friday, May 06, 2016 8:56:34 AM

Work Order ID: 145982

145982

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 5/16/2016

Required Date: 5/24/2016

Start Qty: 1.00

Required Qty: 1.00

D3566-5

Manufactured No

200

Each

31.0000

1

1

D3566-5

Gasket Center Aft

******all 16/06/2016LocationLoc QtyLoc Code

FG

2

139236

2

FP001

29

140942

3

144273

26

21

D3566-1

Manufactured No

200

Each

34.0000

2

2

D3566-1

Gasket Aft / Fwd

******all 16/06/2016LocationLoc QtyLoc Code

FG

8

117012

4

139221

4

FP001

26

139221

4

140819

1

142848

21

B145822x2

D3564-11

Manufactured No

200

Each

8.0000

1

1

D3564-11

Wearplate Aft

******all 16/06/2016LocationLoc QtyLoc Code

FG

4

77056

4

FP002

4

144203

4

B145652x1

Friday, May 06, 2016 8:56:34 AM

Shop Packet Print

Page 5

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause				FAULT CATEGORY					
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐				Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐					
OTHER : ☐									

Picklist Print

Page 6

Friday, May 06, 2016 8:56:34 AM

Work Order ID: 145982

145982

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 5/16/2016

Required Date: 5/24/2016

Start Qty: 1.00

Required Qty: 1.00

D3564-13

Manufactured No

200

Each

3.0000

1

1

D3564-13

Wearpad Fwd

******all 16/06/2016LocationLoc QtyLoc Code

FG

2

B144946

xl

89044

2

FP001

1

137738

1

D3564-9

Manufactured No

200

Each

14.0000

1

1

D3564-9

Wearplate Fwd

******all 16/06/2016LocationLoc QtyLoc Code

FG

6

B145030

xl

76950

4

88407

2

FP002

8

142431

8

D3564-5

Manufactured No

200

Each

28.0000

1

1

D3564-5

Wearplate Center

******all 16/06/2016LocationLoc QtyLoc Code

FG

3

B142890

xl

34806

1

89048

2

FP002

25

144896

25

Friday, May 06, 2016 8:56:34 AM

Shop Packet Print

Page 6

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence				
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____							
Misidentified ☐	☐ Past Due								

Picklist Print

Page 7

Friday, May 06, 2016 8:56:34 AM

Work Order ID: 145982

145982

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 5/16/2016

Required Date: 5/24/2016

Start Qty: 1.00

Required Qty: 1.00

D2594-3

Manufactured No

200

Each

474.0000

16

16

D2594-3

O-Ring

lll 16/06/2016

Location

Loc Qty

Loc Code

FP001

474

134838

116

135859

24

137829

30

138060

2

140770

2

141703

300

x16

D2594-1

Manufactured No

200

Each

171.0000

16

16

D2594-1

Plug

lll 16/06/2016

Location

Loc Qty

Loc Code

FP001

171

119830

68

134804

16

135914

13

141080

14

142475

28

42807

25

88922

7

B145971

✓16

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

LIST OF MATERIALS						
ITEM	QTY -041	QTY -045	QTY -047	QTY -049	PART NUMBER	DESCRIPTION
1	X				D2580-041	SKIDTUBE ASSEMBLY
2		X			D2580-045	SKIDTUBE ASSEMBLY
3			X		D2580-047	SKIDTUBE ASSEMBLY
4				X	D2580-049	SKIDTUBE ASSEMBLY
20	1	1	1	1	D2500-1-190	EXTRUSION
21			16	16	D2570	BUSHING
22	1	1	1	1	D2578-3	STEP
23		4			D2579	SPACER
24	16	16	8	8	D2594-1	PLUG
25	16	16	8	8	D2594-3	O-RING
26	1	1	1	1	D2596	205 WEB
27	1	1	1	1	D2855	AFT CAP
28	1	1			D3564-5	WEARSHOE
29	1	1			D3564-9	WEARSHOE
30	1	1			D3564-11	WEARSHOE
31	1	1			D3564-13	WEARSHOE
32	2	2			D3566-1	GASKET
33	1	1			D3566-5	GASKET
34	1	1			D3566-13	GASKET
35	20	20	24	24	D4202-1	SPACER
36			1		D4408-041	WEARPLATE ASSEMBLY
37			1		D4406-043	WEARPLATE ASSEMBLY
37				1	D5061-1	FWD WEARPLATE
37				1	D5061-3	AFT WEARPLATE
50	50	50			ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
51	50	50			AN3C4A	BOLT
52	2	2	2	2	AN3-5A	BOLT
53			8	8	AN4-45A	BOLT
54	50	50			NAS1149C0332R	WASHER (AN960C10L)
55	2	2	2	2	NAS1149D0332J	WASHER (AN960JD10L)
56			8	8	MS21042-4	NUT (OR MS21042L4)

GENERAL NOTES:


- MATERIAL: N/A
- FINISH: CHEMICAL CONVERSION PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ASSEMBLY (-041/-047/-049) GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3 POWDER COAT ASSEMBLY (-045) GREEN SANDTEX (REF 4.3.5.8) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: NONE
- WEIGHT: D2580-041 = 34.5 lbs
D2580-045 = 34.5 lbs
D2580-047 = 45.1 lbs
D2580-049 = 32.0 lbs
- WELDING PER DART QSI 004.
- INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- USE DART DRILL TEMPLATE DT8217 & DT8937 ONLY FOR D2580-041/-045 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTIONS B-B AND F-F (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241/-291.
- INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (18 PLACES FOR D2580-041/-045 AND 8 PLACES FOR D2580-047/-049)
- IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

RELEASED
2014-04-29

G	ADDED -049, -047 WEIGHT UPDATED PER DSI 9598	AJS	14.04.09
F	INCORPORATE DEO D2580-E-1 PER PAR12-218	DC	13.06.20
E	ADD D2580-047 (ZN C4-7) AND D2580-7 (ZN B3-8); INCLUDED DEO D2580-D-1; REFORMATTED DRAWING TO CURRENT STANDARDS; DT8217 & DT8937 WAS TD2577-205 (ZN C4-1)	RF	11.06.21
D	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/ 9183	PH	07.04.05
C	REDRAWN, INCLUDED DEO 9094/ 9097	CP	98.08.26
B	AS MANUFACTURED	DS	96.12.02
A	NEW ISSUE	DS	96.09.16
REV.	DESCRIPTION	BY	DATE
DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	DS	D2580	SHEET 1 OF 9
APPROVED	DS	TITLE	SCALE
DE APPR.	DS	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1999 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	



w/o 145982

28m 16/05/06

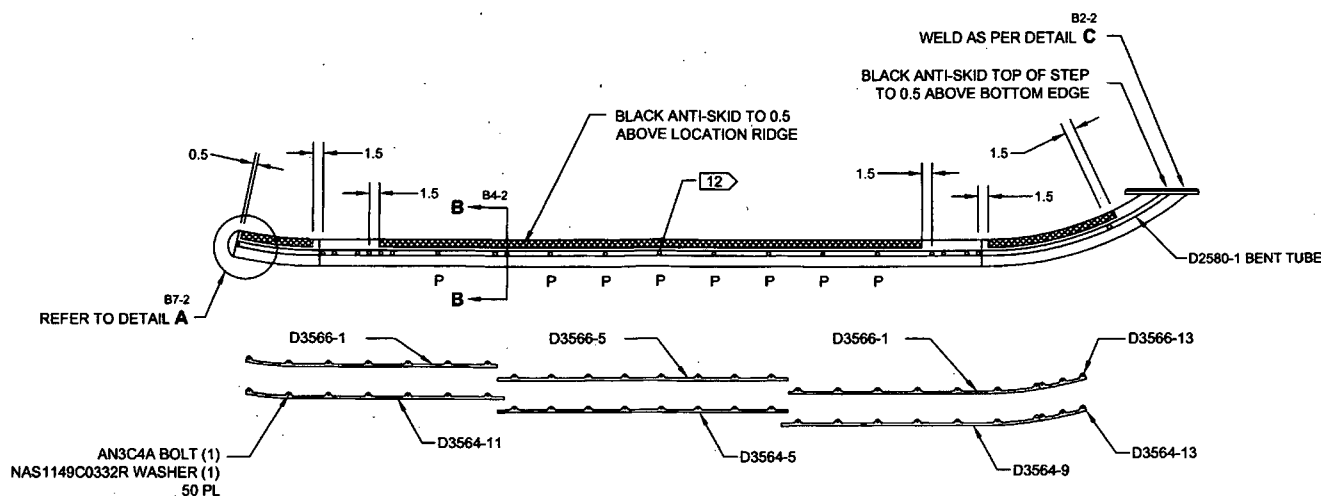


D2580-041 ASSEMBLY DETAIL


RELEASED
2014-04-29

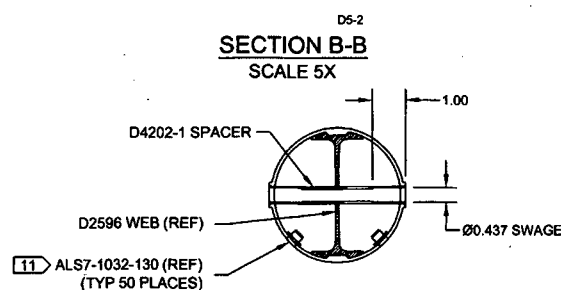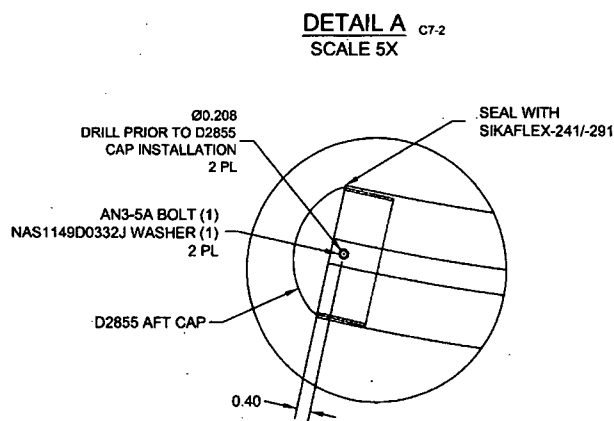

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (20 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM / GRIND FLUSH PER QSI 002

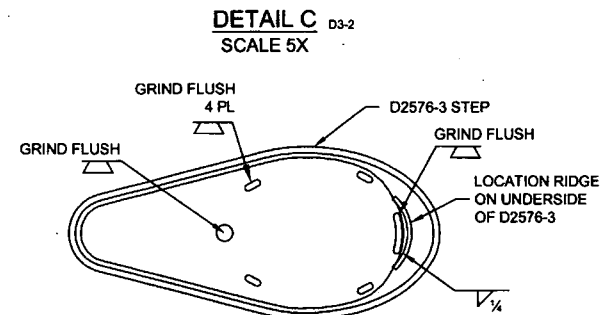


DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	M.P.	D2580	SHEET 2 OF 9
APPROVED	M.P.	TITLE	SCALE
DE APPR.	M.P.	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

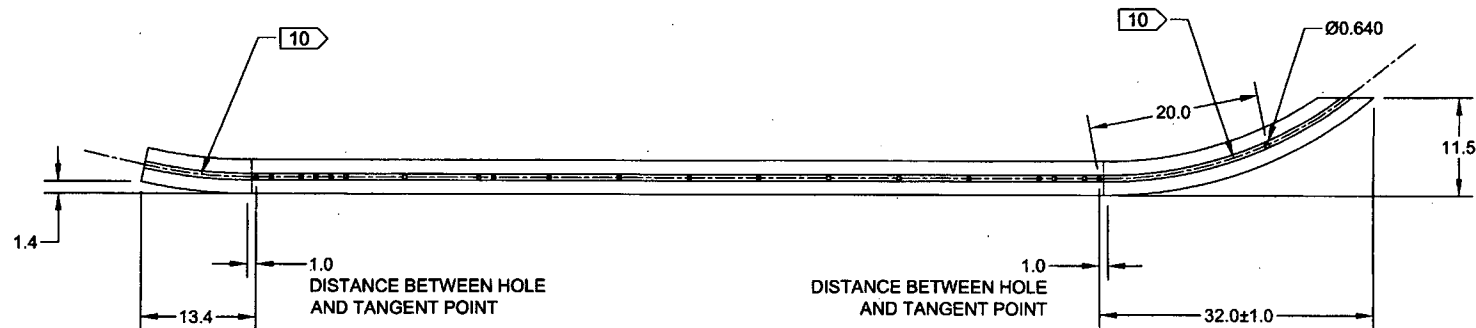

D2580-1 BENT TUBE
(MAKE FROM D2580-101 TUBE)


RELEASED
2014-04-29

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.		D2580	SHEET 3 OF 9
APPROVED		TITLE	SCALE
DE APPR.		205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

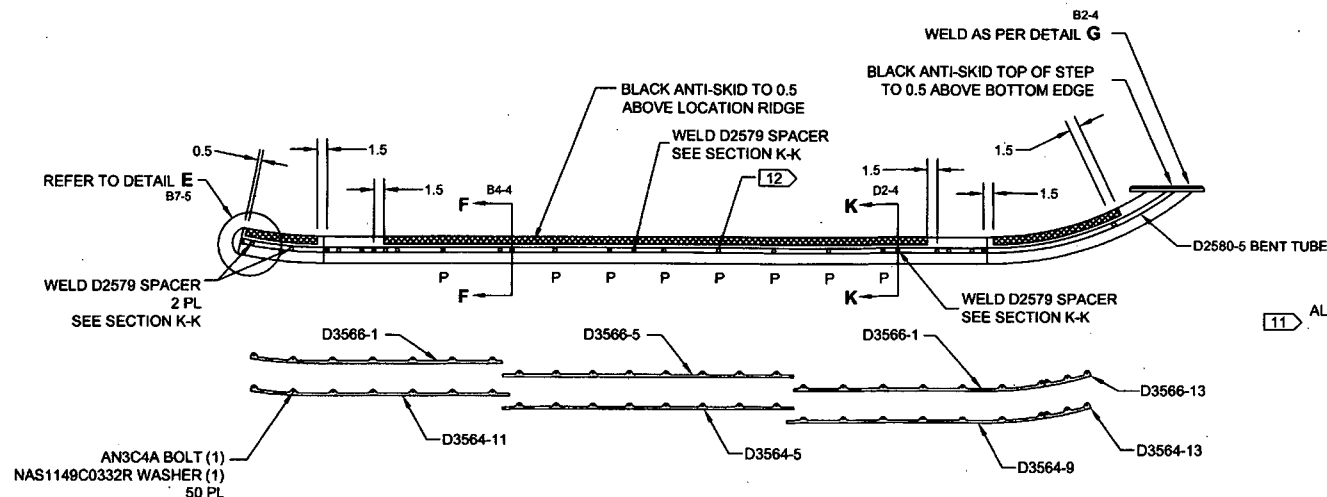


D2580-045 ASSEMBLY DETAIL

SECTION K-K D5-4
SCALE 5X

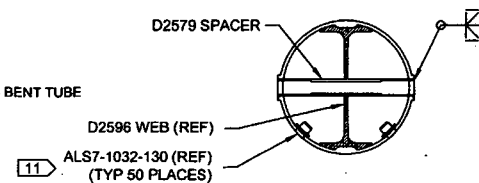


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (4 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. DO NOT C'BORE

DETAIL E D7-4
SCALE 5X

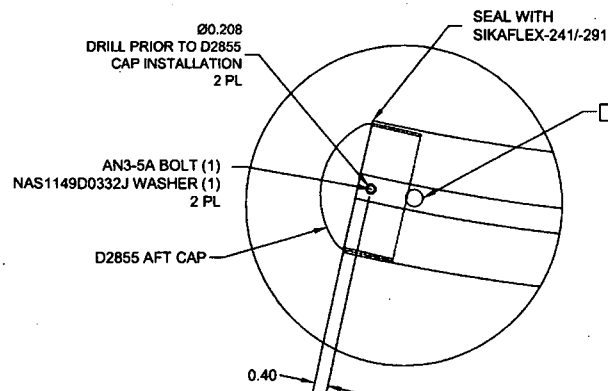


SECTION F-F D5-4
SCALE 5X

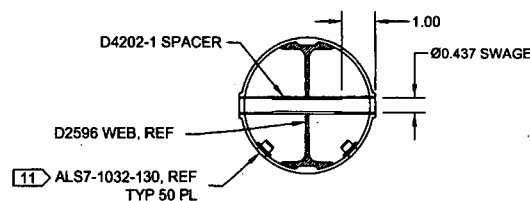


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (20 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

DETAIL G D3-4
SCALE 5X

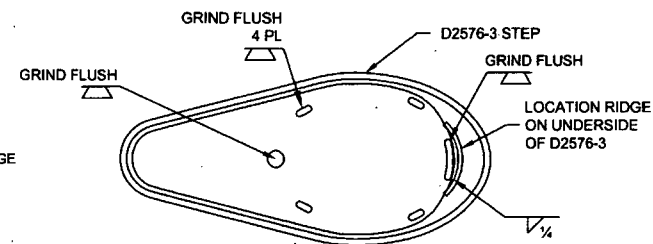

RELEASED
2014-04-29



DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	AJS	DRAWING NO.	REV. G
MFG. APPR.		D2580	SHEET 4 OF 9
APPROVED		TITLE	SCALE
DE APPR.		205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

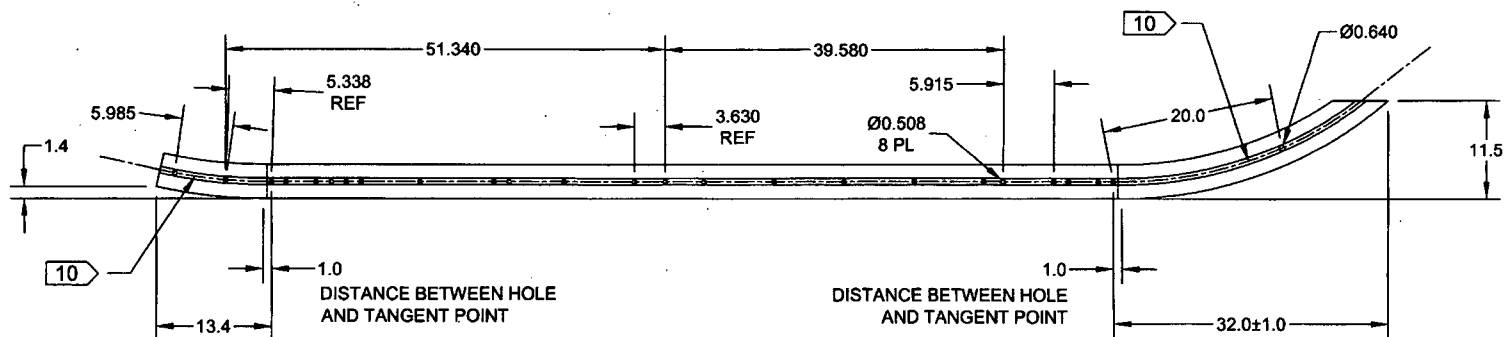


D2580-5 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2014-04-29

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	<i>g.l.</i>	DRAWING NO.	REV. G
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 5 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	





COPYRIGHT © 1996 BY DART AEROSPACE LTD

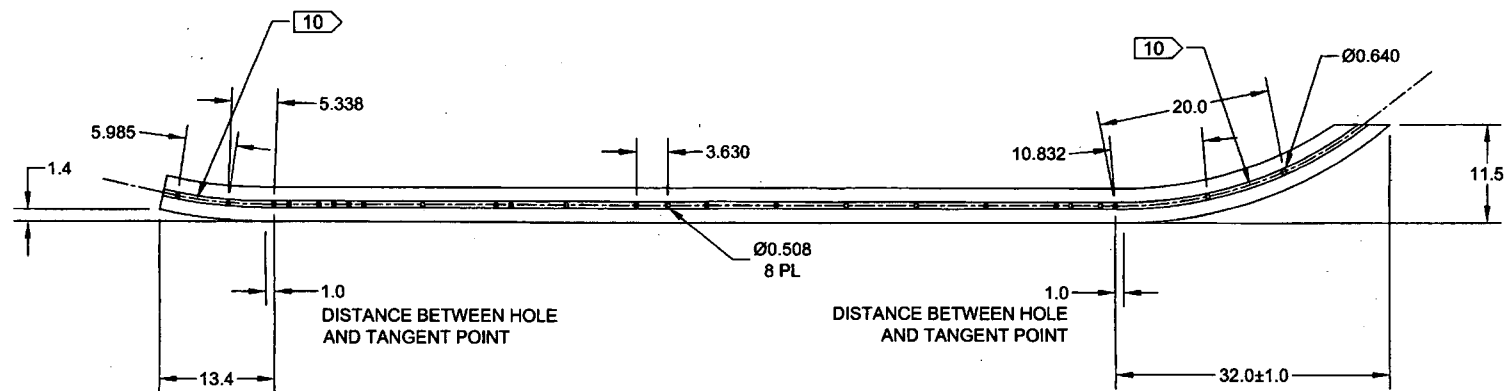

D2580-7 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2014-04-29
W

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 8 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

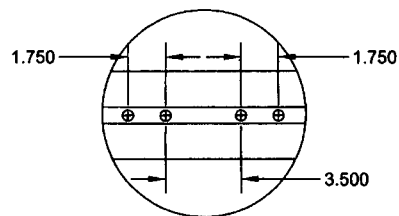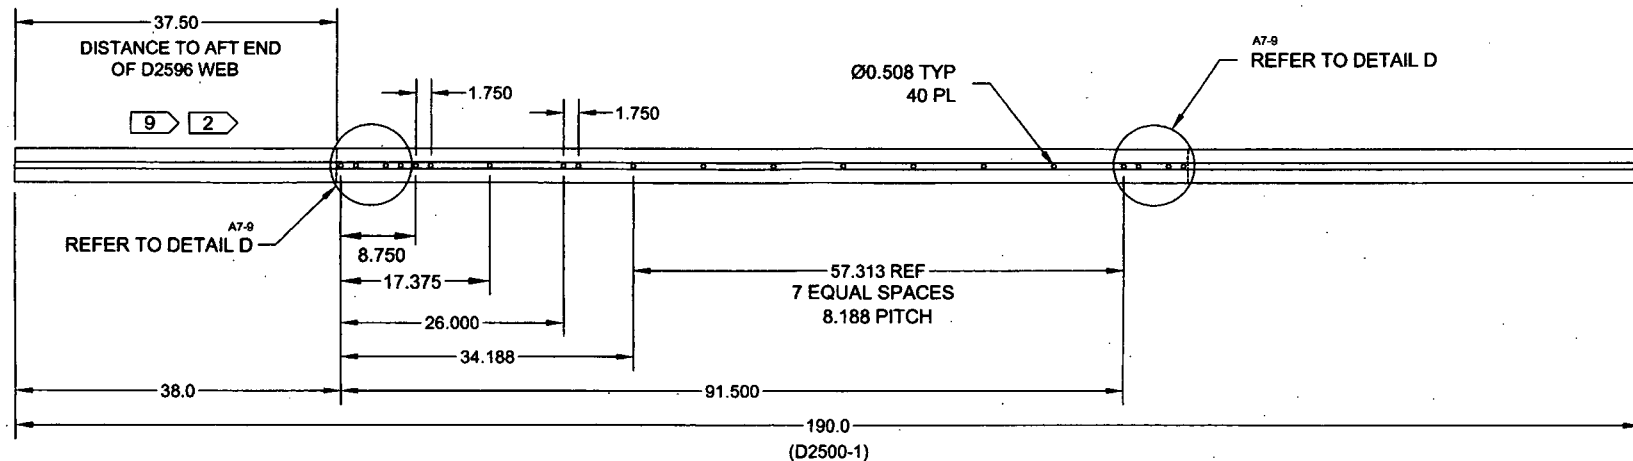

DETAIL D
SCALE 5X

C3-9
C7-9

D2580-101 TUBE

RELEASED
2016-04-29
MD

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.		D2580	SHEET 9 OF 9
APPROVED		TITLE	SCALE
DE APPR.		205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

Work Order ID 145399

Thursday, May 05, 2016 3:28:08 PM

145399

Page 1

Item ID: D205-634-011

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Skidtube with Standard Wearplates Fits LH or RH

Start Date: 5/20/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 5/30/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: dem Date: 16/05/06 Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
DSI9468	A	JUN 2 2 2016	DAE	6					
IIN D205-634	H		9-89						

MS JUN 2 3 2016

100

Document Control

0.00

100

DC

Memo

0.00

Doc.Control -USB or Paperwork

Photocopy bluefile &type labels per PPP D205-634-011
CHG 010

110

Pick Kit

0.00

110

Packaging

Memo

0.00

Packaging